

Investigation of Gold Electrodes Surface Condition of Plasma Reactor

Sebastian Gnapowski ^{1*}, Elżbieta Kalinowska-Ozgowicz², Mariusz Śniadkowski³, Aleksandra Pietraszek⁴

¹ Lublin University of Technology, Fundamentals of Technology Faculty; sgnapowski@wp.pl

² Lublin University of Technology, Fundamentals of Technology Faculty; kalinowska-ozgowicz@tlen.pl

³ Lublin University of Technology, Fundamentals of Technology Faculty; m.sniadkowski@pollub.pl

⁴ Lublin University of Technology, Fundamentals of Technology Faculty; aleksandra.pietraszek@op.pl

* Correspondencesgnapowski@wp.pl

Abstract

During the long-term operation of the plasma reactor, decreases in the plasma concentration were noticed despite the constant maintenance of all parameters. One of the factors is the decrease of the nitrogen content on the surface of the electrode, in order to eliminate it, the supply voltage has been increased to 11 kV. The next decisive factor in the decrease of plasma concentration is the oxidation of the electrode surface, therefore two electrodes were used: first one with solid gold and the other one copper covered with galvanized gold with a thickness of 10 μm . During the experiment, a large decrease in plasma concentration was observed when the electrode coated by gold was used. High-energy electrons have knocked out the gold atoms from the electrode, as a result of which the gold evaporated and the raids layers formed. After a month of working of the electrodes, metallographic researches were carried out, the results of which are described in this publication.

Keywords: gold; surface of electrodes; ozone; plasma; raids layer

1. Introduction

The factor that determined the investigated of electrodes used in the plasma reactor was the decreasing performance of the device during ozone production while maintaining constant process parameters [1-3]. The only noticeable change during the reactor operation was the change in the surface condition of the electrodes used (Figure 1) and the concentration of the ozone produced Figure 2. Ozone concentration decreased with working time day by day and during experiment with copper coated by gold electrode ozone concentration decreased close to zero [4-6]. The plasma reactor was operated at elevated voltage to eliminate the ozone zero phenomena effect. At higher voltages, nitrogen absorbed on the surface of the electrode is released and takes part in the ozone formation process. This is due to Einstein's theory, because when an electron collides with an oxygen molecule, two oxygen atoms are created plus the energy that nitrogen must absorb, otherwise no ozone is formed [3, 7].

After one month of operation, the electrode made of copper galvanized coated with gold had a matt surface with a dark coating indicating the presence of a layer of oxidation products – Figure 1b. Gold was minted by energetic plasma electrons and evaporated. The gold electrode showed no macroscopic changes in polish and surface coloring – Figure 1a [8, 9].

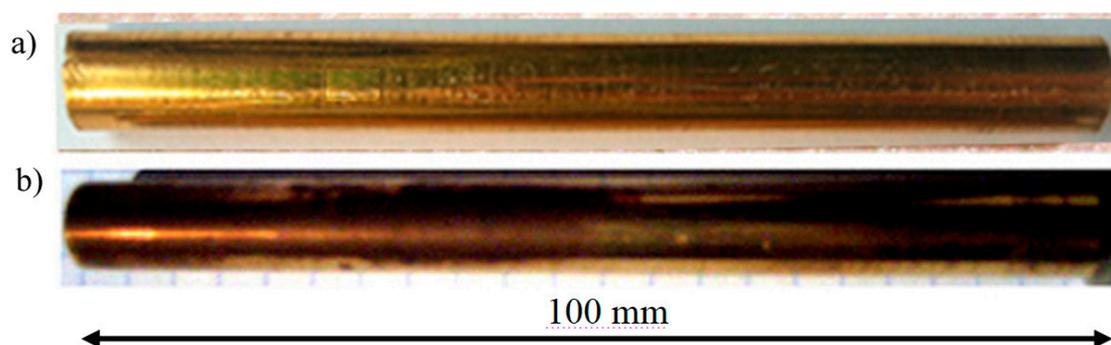


Figure 1. Photograph of electrodes after monthly use in a plasma reactor a) gold electrode, b) copper electrode galvanized coated with gold

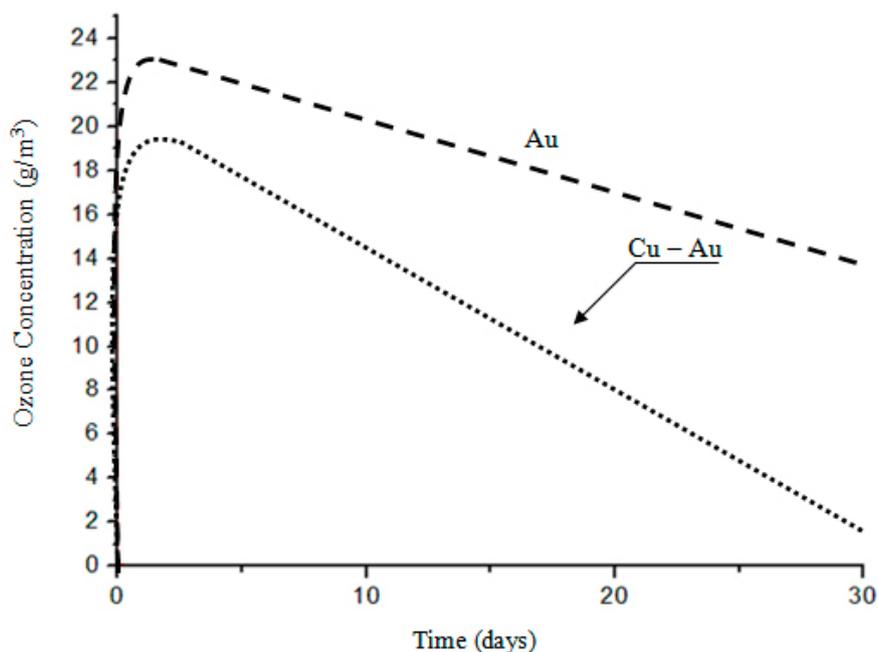


Figure 2. Dependence between ozone concentration and working time of electrodes

The aim of the experiment was to determine the structural effects of the chemical corrosion process of the surface of rotating electrodes operating in the environment of dynamic oxygen flow and ozone in an electric field of a defined intensity [1, 2, 10-12].

The scope of work includes:

- preparation of research material;
- metallographic research of the electrode material in the scope of microstructure and geometry, construction and phase composition of the raids layers on their surface;
- identification of interstitial phases in the raids layers using X-ray diffraction and scanning electron microscopy;
- microanalysis of the chemical composition of the raids layers using the EDX attachment in the scanning electron microscope.

2. Materials and Methods

The experimental material consisted of electrodes made of a solid copper coated electroplated with 24 carat gold of 10 μm thickness and a 10 mm solid gold. The chemical composition of electrode materials is given in the Table 1.

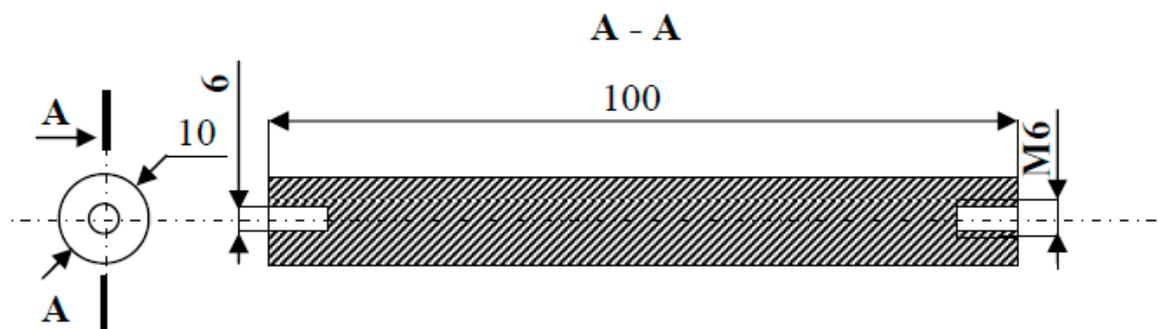


Figure 3. The shape and dimensions of the electrode made of gold

Experimented electrodes in the form of rollers with a length of 100 mm and a diameter of 10 mm had an M6 internal thread on one side and on the other, a hole \varnothing 6 mm with milling for the clamping wedge on the drive shaft – Figure 3.

To determine the structure of the materials used for electrodes and to comprehensively evaluate the metallographic effects of chemical corrosion of the surface of electrodes occurring during the plasma production process, experiments were carried out using light microscopy, scanning electron microscopy and X-ray phase abanation.

Metallographic microscopic investigations were carried out on the material cut off from the electrodes after their 30-day operation. The cut material was embedded in a self-hardening resin and grinded mechanically on aqueous abrasive papers. Grinded microsections were polished mechanically using diamond pastes with different granulation and the gold electrode was purified in the reagent being a compound of sulfuric and nitric acid. Metallographic observations and grain surface measurements were performed using the OLIMPUS GX71 reflecting optical microscope using a computer image analysis system using zoom from 100 to 2000x.

X-ray researches performed with the diffractometric method included a qualitative X-ray phase analysis of the electrode surface after thirty days of use in a plasma generator. Electrode X-ray investigation were carried out using an Empryean X-ray diffractometer from PANalytical. The investiagetiions were carried out using a parallel beam technique in configuration with a Pixel cobalt anode $\text{Co}\lambda\text{K}\alpha$ anode at 35 kV and an anode current of 25 mA. X-ray, qualitative phase analysis was carried out in the range of 2θ angles from 10° to 100° corresponding to the interplanar distances between 1.027 nm and 0.1168 nm. The experimental conditions were ensured in which the resulting diffractograms represent the material of the surface layer of the research electrodes. The identification of the phase composition of the layers formed on the surface of the research electrodes was based on the base of the International Center for Diffraction Data PDF - 4 + version 2015.

Research using a scanning microscope was carried out to assess the structure of electrodes and chemical composition in micro-areas of raids layers formed as a result of the oxidation process. Observations were made on metallographic microsections using the ZEISS SUPRA 35 electron microscope. The investigation used a side and intra-lens detector, using secondary electrons detection. The chemical composition of the micro-areas of the raids layers was determined using the EDX system. The observation was carried out at a 20 kV accelerating voltage using a zoom up to 2000 times.

3. Results

The first a gold layer applied galvanically to the surface of the copper electrode was investigated.

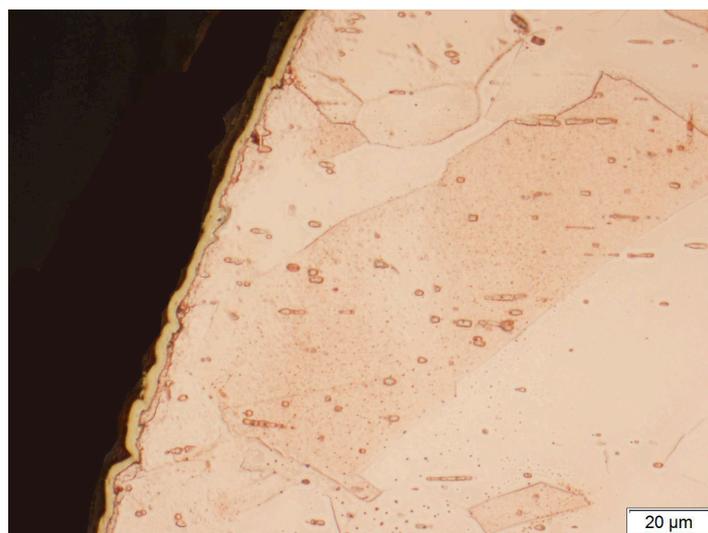


Figure 4. A gold layer applied galvanically to the surface of the copper electrode

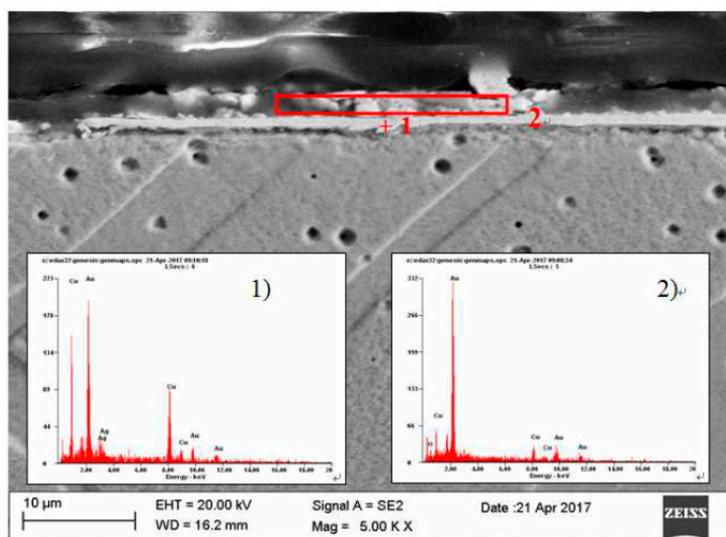


Figure 5. Results of point (1) and surface (2) microanalysis of the chemical composition of the coating layer on electrolytically gold deposited on copper

Table 1. Results of microanalysis of the chemical composition of the coating layer on a copper electrode with electrolytically gold deposited.

Element	Place of measurement			
	1		2	
	% wag	%at	% wag	% at
OK	04,16	28,69	---	----
CuK	14,93	25,95	38,12	63,29
AuL	80,91	45,36	54,17	29,06
AgL	----	-----	07,71	07,55

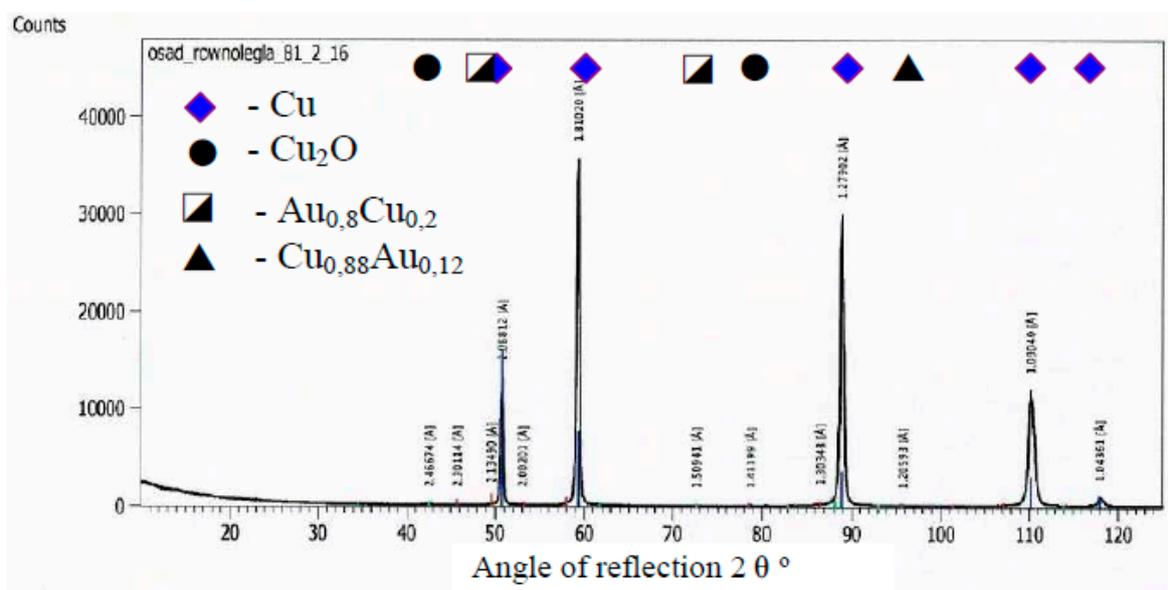


Figure 6. A diffractogram of the surface of a copper electrode galvanized coated by gold

Solid gold electrode

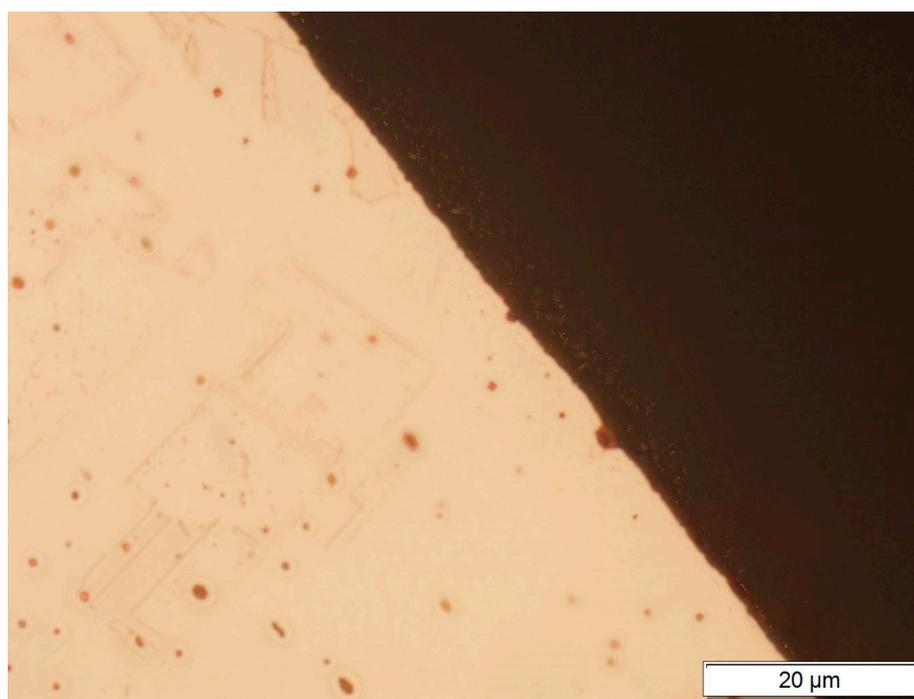


Figure 7. Gold electrode photography

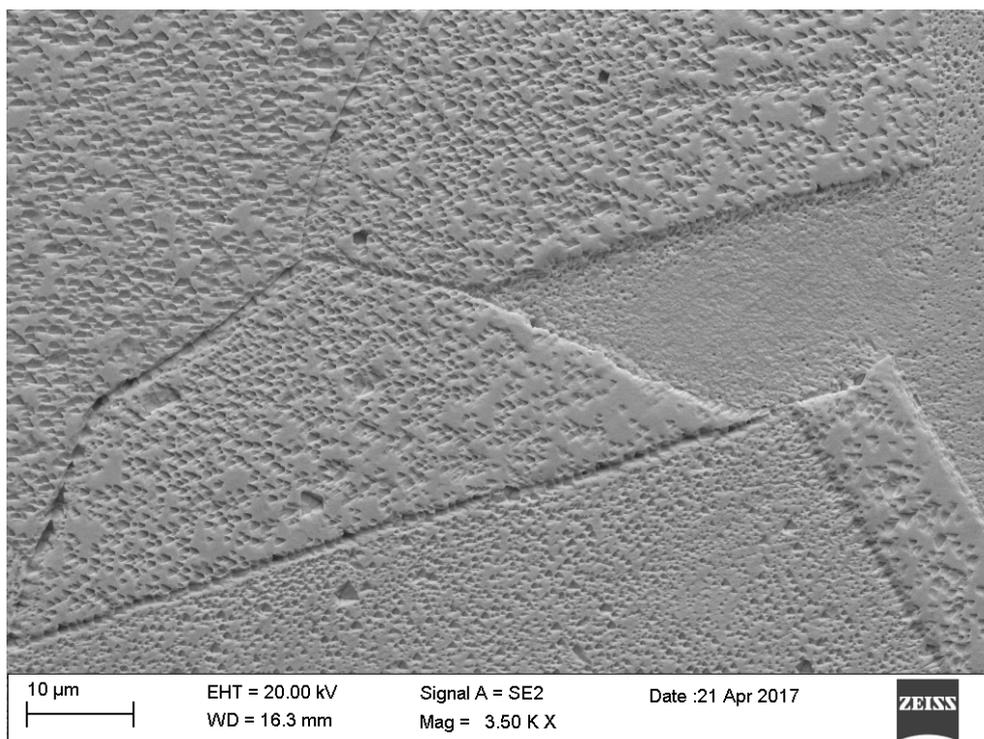


Figure 8. Large Au grains with twins in the structure

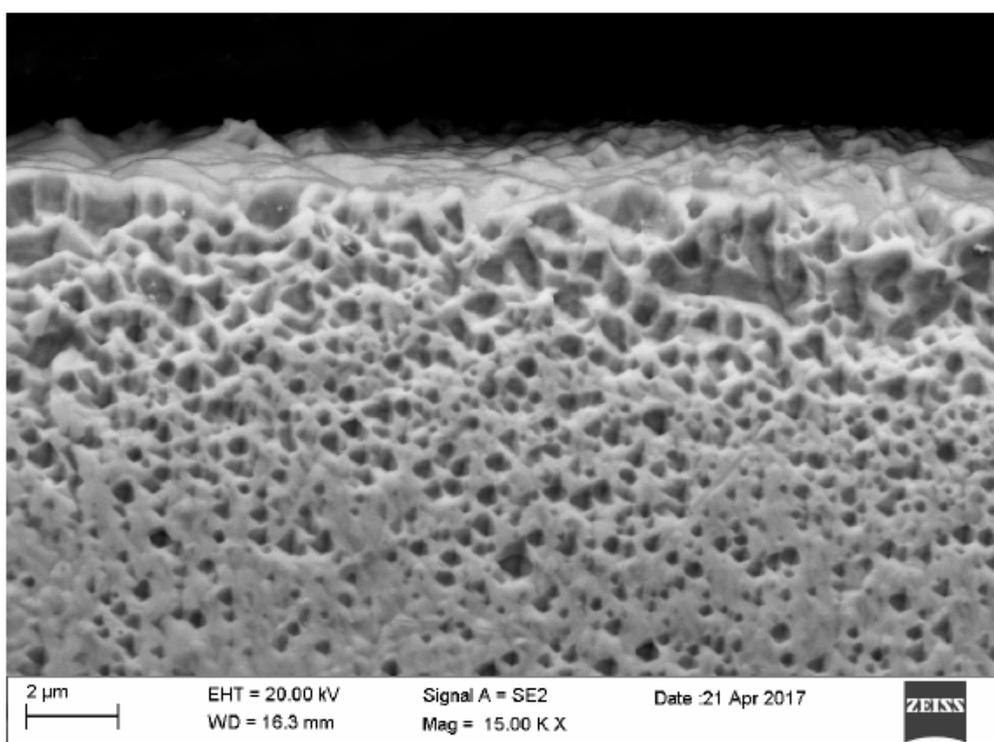


Figure 9. Surface of gold electrode

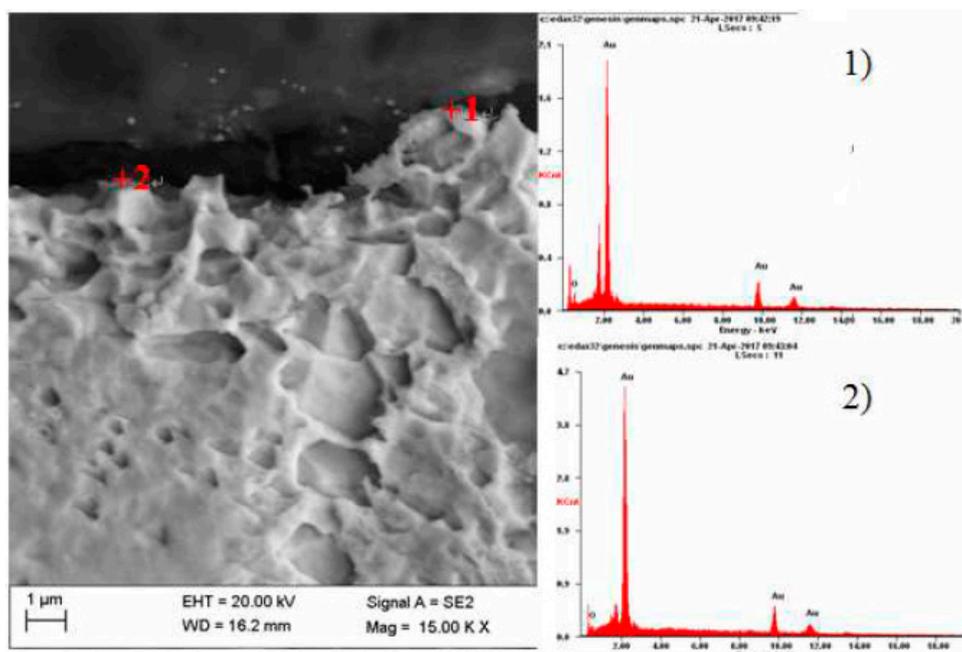


Figure 10. Results of microanalysis of the chemical composition of the Au electrode, from the areas marked in the photomicrographs

Table 2. Results of the quantitative microanalysis of the chemical composition of the Au electrode surface

Element	place of measurement			
	1		2	
	% wag	%at	% wag	% at
OK	05,14	40,01	02,29	22,37
AuL	94,86	59,99	97,71	77,63

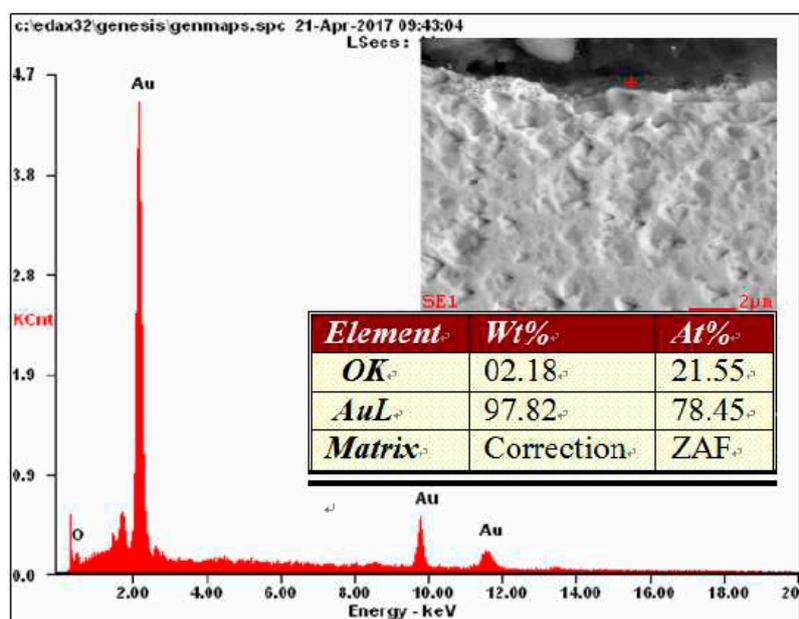


Figure 11. Results of microanalysis of the chemical composition of the Au electrode

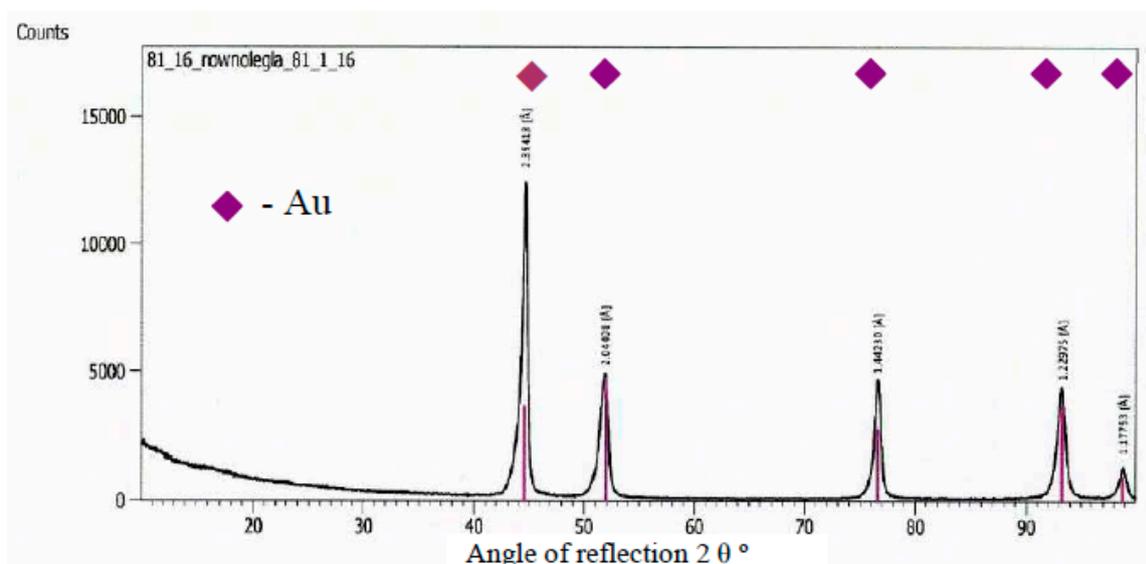


Figure 12. A diffractogram from the Au electrode surface

Discussion

Structural researches of electrodes were carried out by metallographic observation using light microscopy, X-ray microanalysis as well as phase analysis using scanning electron microscopy. The subject of metallographic research was the assessment of the structure of the electrode material as well as the geometry of the raids layers on the surface of the electrodes after the monthly operation in the ozonator. The determination of the phase composition of the raids layers and their chemical composition in the micro-areas required the use of X-ray diffraction and the MAR method with high resolution. The results of metallographic observations using a light microscope are included in micro photographs – Figures 4, 7. X-ray analysis results were presented on the diffraction patterns – Figures 6, 12, and microanalysis made with the use of EDX, scanning electron microscopy on micro photographs (Figure 5, 8, 9, 10) and in Tables 1, 2.

Based on the results of metallographic research, it was found that the layers occurring on electrodes subjected to corrosive aggressive environment of oxygen and ozone during monthly operation in the plasma reactor, whose thickness does not exceed 10 μm , are characterized by the geometry corresponding to the coating layers.

A copper electrode with a galvanically applied layer of gold after a month's use is characterized by a structure of large recrystallized copper grains with straight lines and a discontinuous layer of gold – Figure 4. Between the galvanic layer of gold and copper there are areas with no adhesion, mainly at the points where the boundaries between Cu and Au layers meet. – Figure 5. The structure of the electroplated Au layer and the occurring discontinuities may be the reason for ejecting gold atoms from the galvanic layer onto the plasma reactor housing during its operation, formation of discontinuities in the layer, progress of the surface oxidation process and, as a result, a decrease in ozone concentration during the work of the plasma reactor. Observations using the scanning electron microscope revealed the occurrence of oxidation effects in the form of a very thin raid layers on the surface of the electrode. Thickness of the raids layers on the AuEC electrode is in the range of 0.778 μm to 1 μm . X-ray research made it possible to determine the phase state of the raids layers on the investigated electrode. X-ray diffraction lines are from the planes (111, 200, 220, 311) of the following phases Cu, Cu₂O, Au_{0.88}Cu_{0.12} and Cu_{0.88}Au_{0.12}.

The analyzed raids layers on a copper electrode with galvanically applied gold consists of two parts differing both in terms of structure and chemical composition – Figure 5. The construction of the part bordering with copper is massive, sometimes discontinuous, while the part bordering with the atmosphere of oxygen and ozone - segmented – Figure 5. The chemical composition of the bordering copper is copper, silver and gold, and in the bordering part of the atmosphere oxygen, copper and gold – Figure 5, Tabela 1.

Metallographic investigation did not reveal microscopic raids layers on the surface of the electrode made of gold. As a result of the microanalysis of the chemical composition using EDX, however, the presence of oxygen in several micro-areas on the surface of this electrode was revealed. – Figure 10, 11.

In the gold structure, very large grains were observed with annealing twins and geometrical figures inside the grains – Figure 8. The average surface size of the grains disclosed is from about 0.25 mm² to 1.15 mm² – Figure 8. In addition, observations in the scanning microscope allowed to state that the surface of the golden electrode is characterized by a very large development line – Figure 9.

On a diffractogram made in X-ray research from Au surface there are only diffraction lines originating from the gold planes with indicators (111), (200), (311) and (222) corresponding to the interplanar distances, respectively: $d = 2,35\text{\AA}$, $2,04\text{\AA}$, $1,44\text{\AA}$, $1,29\text{\AA}$ i $1,17\text{\AA}$ – Figure 12. However, quantitative microanalysis from micro-areas of the electrode surface made using EDX showed the presence of oxygen in the experiments micro-areas – Figure 10, 11, Table XX. The research results do not allow to determine the presence of raids layers on the surface of the electrode made of gold. The occurrence of oxygen in micro-areas on the surface of the electrode was found. This is the reason for the slight decrease in the amount of ozone produced. Due to the great ease of oxygen to form compounds, it can be assumed that in the micro-areas in which the presence of oxygen is revealed there are probably gold oxides ($\text{Au}_{0.6}\text{O}_{0.4}$, $\text{Au}_{0.78}\text{O}_{0.22}$) – Table 2, Figure 11.

5. Conclusions

In the ozone production process, the plasma reactor electrode works in an aggressive environment of generated ozone. As a result of working in such conditions, the electrode is oxidized in the process of chemical corrosion. The layer of corrosion products created during the work of the plasma reactor isolates the surface of the electrode, which reduces the intensity of the electric field, causing a decrease in the amount of plasma generated, which is a direct cause of lowering the concentration of ozone during this process.

The dynamics of the plasma generation process and the type of electrode material working in changing process conditions are the decisive factors affecting the concentration of ozone produced. Two electrodes were compared, the surface layer of which was the same, made of gold, and showed different plasma generation characteristics during operation. The influence of the medium, which is the electrode material, depends mainly on its resistance to corrosion in the environment of dynamically changing conditions, ie electrode rotation, oxygen flow through the rotating electric field and the long monthly working time of the plasma reactor. Corrosion products formed on the surfaces of individual electrodes after 30 days of work in the plasma reactor showed different geometry, structure and chemical composition in the micro-areas of the raids layers. The raids layer formed during the operation of the copper electrode with electrolytically deposited gold is from 1.5 μm to 2.0 μm and has a double-layer form. The first one, bordering with copper, is a discontinuous electroplated coating with a thickness of 0.78 μm , and the other, located at the border with the environment, is a layer of fragmented form with a thickness of about 2.0 μm . The microanalysis of the layer bordering with copper showed that its chemical composition is Au, Ag, O and Cu, while in the layer bordering with the environment - oxygen, gold and copper. The formation of the raids layer in this form is the result of a local disappearance of galvanically deposited gold during the plasma generation process and the deposition of this metal on the walls of the plasma reactor. The electrode surface deprived of the protective layer of gold oxidized. The reason for this behavior of the electrode is the fact that gold used as a coating material with a high positive electrochemical potential protects the electrode surface (copper) only in a mechanical way, not an electrochemical one.

On the surface of the gold electrode, in the microscopic and X-ray investigation no continuous coating was found. However, research using the scanning electron microscope allowed to reveal the presence of oxygen in the micro-areas of the electrode surface. In the chemical composition of the analyzed micro-areas, the amount of oxygen is about 10%.

References

1. Dhainauta M., Odieb E., Goldmana M., Goldmana A. and Karimib C., "Dependence of the oxidation properties of a dielectric barrier discharge in air on the plasma and gas temperatures", 8th International Symposium on High Pressure Low Temperature Plasma Chemistry, Hakone IIX, Tartu, Estonia, 2002
2. Głowacki Z., Zbiór odczynników metalograficznych, PWN, Warszawa 1952.
3. Gnapowski S., Akiyama H., Hamid S. R. Hosseini, and Yamabe Ch., "Effect of Rotating Electrode", World Academy of Science, Engineering and Technology – Research Journal, ISSN: 2010-376X ISSUE 0079/07/2013, International Science Index 79, 7(7), (2013), pp. 1264 – 1271
4. Gnapowski S., Akiyama H., Lenik K., "New possibility for the use of plasma discharges to identify amber and changes in amber structure", Advances Science and Technology – Research Journal, ISSN 2080-4075, Vol. 6, 16/2012, (2012), pp. 1-6
5. Gnapowski S., Gnapowski E., "Effects of Rotating Electrode during Plasma Generation", ISBN 978-3-659-51292-6, LAP Lambert Academic Publishing, (2014)
6. Gnapowski S., Gnapowski E., Śniadkowski M., "Demand effect of nitrogen using reactor with a rotating type electrode", Ciência e Técnica Vitivinícola Journal (ISSN: 0254-0223) – 2015, ISSN:0254-0223 Vol. 30, no. 6, (2015), pp. 36 - 54
7. Gnapowski S., Gnapowski E., Śniadkowski M., Ciekankowski Z., "Using of pulsed plasma discharges and shock wave generator to identify the amber", Ciência e Técnica Vitivinícola Journal (ISSN: 0254-0223) – 2015, ISSN:0254-0223 Vol. 30, no. 6, (2015), pp. 12 - 22
8. Gnapowski S., Yamabe Ch. and Ihara S., "Ozone Generation Characteristics of Ozonizer with the Rotating Type Electrode", The Institute of Electrical Engineers of Japan, Vol.128, No.10, (2008), pp. 619-623
9. Gnapowski S., Yamabe Ch., Ihara S., Ozonek J. and Lenik, K. "Improving the Ozone Generation Using Ozonizer with the Rotating Type Electrode", Electrical Review, 2009, ISSN 0033-2097, R. 85 NR 5/2009, (2009), pp. 106-109
10. Grabski M.W., Istota inżynierii materiałowej, Oficyna Wydawnicza Politechniki Warszawskiej, Warszawa, 1995.
11. Poradnik galwanotechnika, redakcja; Żak T., Kolanko Z., WNT, Warszawa, 1985
12. Romankiewicz F. – Modyfikacja miedzi i jej stopów, Wyd. Komisja Nauki o Materiałach PAN, Poznań, Zielona Góra, 1999